

# SERVICE INFORMATION



## STANDARD AND TRIUMPH VEHICLES

### (NOT FOR PUBLICATION)

---

<b>No.</b>	SPORTS/2/M	FLASHING SIGNAL LIGHTS	<b>Date</b>	FEBRUARY 1954
------------	------------	------------------------	-------------	---------------

---

This vehicle is fitted with flashing type indicator lights and trouble has been experienced with the failure of the flasher control unit, Part No.107594.

This unit has been fitted horizontally and investigation by Messrs. Lucas has shown that the heat given off by the resistance is affecting the hinge of the contact strip, causing distortion and incorrect operation.

This unit is now fitted vertically (terminals pointing down the scuttle panel) and any replacement units must be fitted in this manner. It is possible to do this without modifying fixing bolts or harness and the latest position is shown in the illustration.

This change was incorporated in production during the month of February, but it is unfortunately impossible to quote a Commission Number at which the change was introduced.


NOTE: These instructions are for information only and do not constitute an authority to carry out modifications at the expense of The Standard Motor Company Limited.

# SERVICE INFORMATION



## STANDARD AND TRIUMPH VEHICLES

(NOT FOR PUBLICATION)

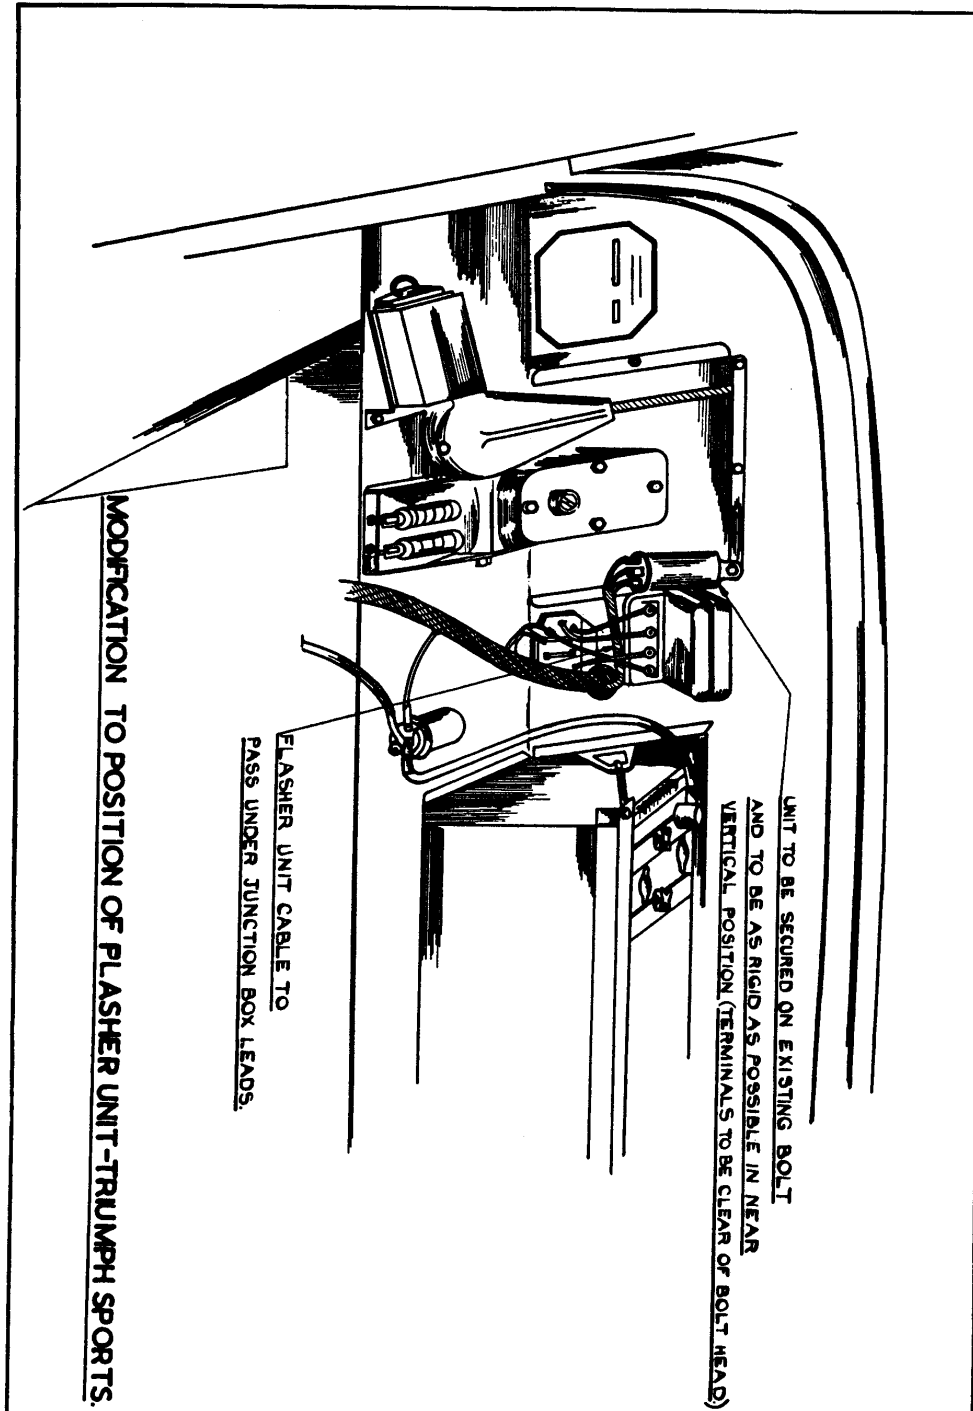

This Sheet gives Important service Information and should be  
filed by your Service Dept. in the Service Information Folder.