

SERVICE INFORMATION



STANDARD AND TRIUMPH VEHICLES

(NOT FOR PUBLICATION)

No.	SPORTS/10/N	FITTING OF LISTING RODS	Date	JULY 1957
------------	-------------	-------------------------	-------------	-----------

In order to prevent the headlining “festooning” when the adhesive fails after a period of service and to obviate the necessity for removing and refining the trim a service scheme for the introduction of a listing stick has been prepared.

The listing stick should be covered with the same material as the headlining and although fitted on the underside of the lining and visible is in no way unsightly.

The listing stick should be fitted as explained in the illustration and the necessary items can be obtained from our Spares Division as per the following details:

<u>Part No.</u>	<u>Item.</u>
605740	Listing stick (1 off).
554929	C.1. rubber solution for cloth.
554928	C.2. compound for use on metal (Goodliff).

NOTE: These instructions are for information only and do not constitute an authority to carry out modifications at the expense of The Standard Motor Company Limited.

1 ILLUSTRATION.

SERVICE INFORMATION



STANDARD AND TRIUMPH VEHICLES

(NOT FOR PUBLICATION)


ISSUED BY: THE ENGINEERING DEPT THE STANDARD MOTOR Co. LTD BANNER LANE COVENTRY

SPRINGS/20/14


TO BE COVERED IN MATCHING
HEADCLOTH SECURED BY :
554929 - CI - RUBBER SOLUTION ON CLOTH
554928 - G2 - COMPOUND ON METAL (GOODLIFF)

LISTING STICK - 605740
(SPRUNG INTO POSITION)

SECTION THRO LISTING
STICK AT 'e'

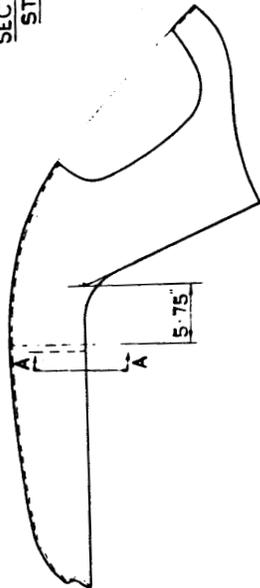

HEADLINING
ROOF PANEL

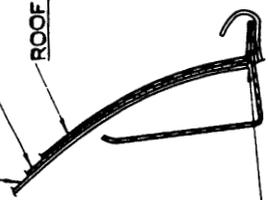

NOTE: WHERE NECESSARY, THAT IS IF LISTING STICKS
HAVE INSUFFICIENT TENSION DUE TO VARYING
ROOF PANEL CONDITIONS, SUITABLE PACKINGS MAY
BE INSERTED IN CANT RAIL UNDER END OF LISTING STICK

DESCRIPTION	MODEL
FITTING OF LISTING STICK	TR. III

This Sheet gives Important service Information and should be filed by your Service Dept. in the Service Information Folder.