


STANDARD-TRIUMPH MOTOR COMPANY, INC.

**WESTERN ZONE**

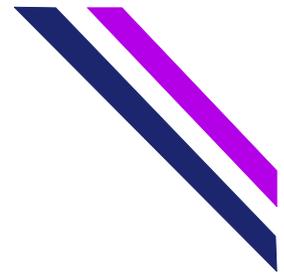

TO: ALL TRIUMPH DEALERS - WESTERN ZONE

DEPT: SERVICE & PARTS

BULLETIN T-63-73

SUBJECT: FRONT SUSPENSION VERTICAL LINK  
HERALD AND SPITFIRE

DATE: DECEMBER 6, 1963

---

At commission number GA-127239, GC-12254 and FC-15576 disc brake condition only, a revised front suspension vertical link was introduced.

Interchangeability is affected and vehicles must be serviced with the original components.

The parts involved are:

Vertical link R.H.	209222	replaced by 306603
Vertical link L.H.	209223	replaced by 306604
Stub axle	132448	replaced by 138556
Dust shield R.H.	208718	replaced by 211046
Dust shield L.H.	208713	replaced by 211047
Tie rod lever R.H.	205504	replaced by 211048
Tie rod lever L.H.	205505	replaced by 211049

Additional details:

Water shield	138559
Bolt 2 off	138558
7/16" spring washer	WQ0310

Drum brake front suspension assemblies are not affected by this change.

These instructions are for information only and do not constitute an authority to carry out modifications at the expense of the Standard-Triumph Motor Company, Inc.