

SERVICE INFORMATION



STANDARD AND TRIUMPH VEHICLES

(NOT FOR PUBLICATION)

No. SPORTS/4/M **REV. COUNTER CABLE FOULING OVERDRIVE RELAY** **Date** DECEMBER 1954

The Rev. Counter Cable was recently lowered in order to improve its "run." In its new position the cable was brought nearer to the relay, where overdrive is fitted, and thus introduced the possibility of an electrical "short" giving overdrive on all gears.

A new Rev. Counter Cable Securing Clip, Part No. 601410, is now fitted, and located on one of the relay securing screws and positioned so as to prevent electrical contact with the relay. The correct positioning of this clip is shown in the illustration.

NOTE: These instructions are for information only and do not constitute an authority to carry out modifications at the expense of The Standard Motor Company Limited.


1 ILLUSTRATION.

SERVICE INFORMATION



STANDARD AND TRIUMPH VEHICLES

(NOT FOR PUBLICATION)

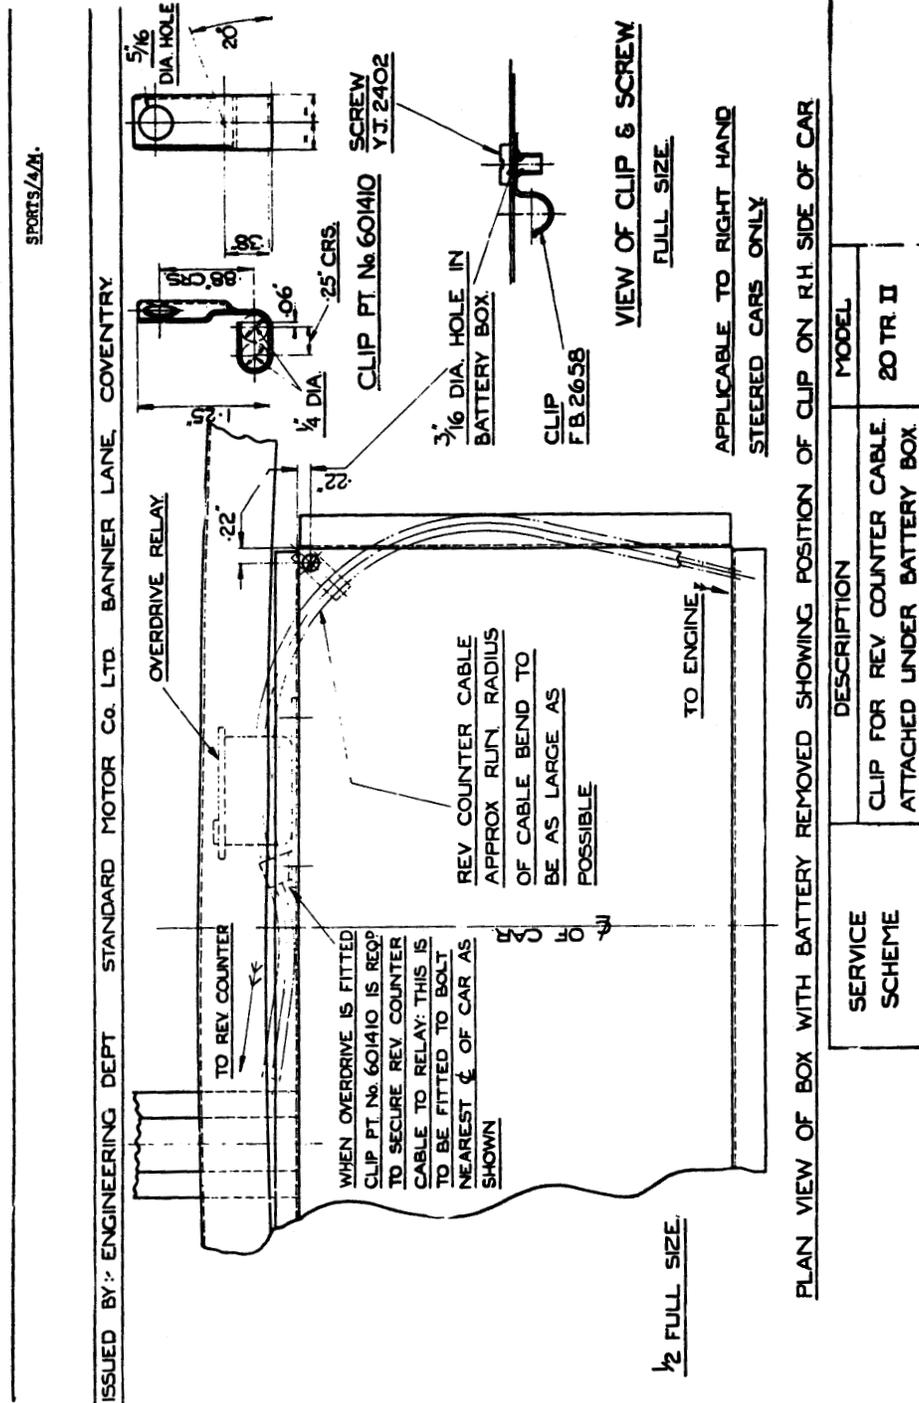

This Sheet gives Important service Information and should be filed by your Service Dept. in the Service Information Folder.